

date 08/05/2022

page 1 of 5

SERIES: PS05 | DESCRIPTION: PRESSURE SENSOR

FEATURES

- temperature compensated
- multiple pressure range options
- absolute and sealed gauge pressure options
- stainless steel housing
- o-ring seal





SPECIFICATIONS

parameter	conditions/description	min	typ	max	units
pressure range	see Pressure Specifications for more details	0		100	MPa
pressure reference	absolute pressure, sealed gauge pressure				
excitation			1.5	2.5	mA
input impedance		2		5	kΩ
insulation resistance	at 250 Vdc	200			МΩ
response time	up to 90%FS			1	ms
vibration	20 G (20~5,000 Hz)				
shock	100 G for 10 ms				
compensated temperature	≤35 kPa models all other models	0 -10		60 70	°C °C
operating temperature		-40		125	°C
storage temperature		-40		125	°C
life		1,000,000			cycles
Rohs	Ves				

MECHANICAL

parameter	conditions/description	min	typ	max	units
measured medium	all 316L compatible liquids and gases	all 316L compatible liquids and gases			
housing/diaphragm	stainless steel 316L				
dimensions	Ø19 x 14		mm		
weight			80		g

BASIC PARAMETERS

parameter	conditions/description	min	typ	max	units
nonlinearity ¹		-0.3	±0.2	0.3	%FS
hysteresis		-0.05	±0.03	0.05	%FS
repeatability		-0.05	±0.03	0.05	%FS
zero output		-2	±0.2	2	mV
full scale span output	≤35 kPa models all other models	40 60	90 90	150 150	mV mV
zero temperature coefficient²	≤10 kPa models all other models	-2 -1.5	±1.5 ±0.75	2 1.5	%FS %FS
span temperature coefficient ²		-1.5	±0.75	1.5	%FS
thermal hysteresis³		-0.075	±0.05	0.075	%FS
long term stability		-0.3	±0.2	0.3	%FS/year

Note:

- 1. Calculated according to best fit straight line (BFSL) least square method.
- 2. In the compensated temperature range, refer to 30°C.
- 3. After passing high and low temperature, return to the reference temperature.

PRESSURE SPECIFICATIONS

pressure range	pressure reference⁴	overload pressure	burst pressure
0~100 kPa	A	200%FS	500%FS
0~250 kPa	A	200%FS	500%FS
0~400 kPa	A	200%FS	500%FS
0~1.0 MPa	A	200%FS	500%FS
0~1.6 MPa	A, S	200%FS	500%FS
0~2.5 MPa	S	200%FS	500%FS
0~4.0 MPa	S	200%FS	400%FS
0~6.0 MPa	S	200%FS	400%FS
0~10 MPa	S	200%FS	400%FS
0~16 MPa	S	200%FS	400%FS
0~25 MPa	S	150%FS	400%FS
0~40 MPa	S	150%FS	300%FS
0~60 MPa	S	150%FS	300%FS
0~100 MPa	S	150%FS	300%FS

Note:

4. A-absolute pressure (vacuum is zero); S-sealed gauge pressure (calibrated atmospheric pressure is zero).

PART NUMBER KEY

PS05 - X XXXX P - 5W Pressuré Reference: Base Number Pressure Range: A = Absolute 100K = 100 kPa 250K = 250 kPa S = Sealed Gauge 400K = 400 kPa 10M = 1 MPa 16M = 1.6 MPa 25M = 2.5 MPa 40M = 4 MPa 60M = 6 MPa 100M= 10 MPa 160M = 16 MPa 250M = 25 MPa 400M = 40 MPa 600M = 60 MPa 1000M = 100 MPa


MECHANICAL DRAWING

units: mm tolerance: ±0.1 mm unless otherwise noted


ITEM	DESCRIPTION	MATERIAL	PLATING/COLOR	
Α	housing	SS 316L		
В	diaphragm	SS 316L		
С	oil filling	silicon oil		
D 0	o-ring	NBR (≤4 Mpa models)	black	
		fluorine rubber (>4 Mpa models)	brown	
E	wires	silicon; OD: 1.4 mm; O.15 mm²		

WIRE CONNECTIONS			
Wire Color Function			
Red	+IN		
Blue	-IN		
Blue	-IN		
Yellow	+OUT		
White	-OUT		


Sealed Gauge Pressure or Absolute Pressure <16 MPa

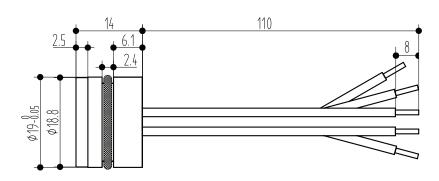

Sealed Gauge Pressure ≥16 MPa

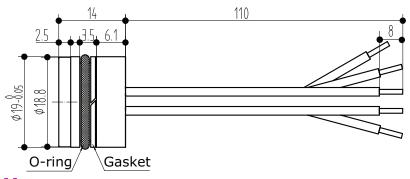

INTERFACE DIAGRAM

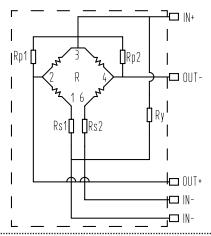

cuidevices.com

Additional Resources: Product Page | 3D Model

USAGE CONSIDERATIONS

- 1. Do not touch the diaphragm with hard objects, which may cause damage to the diaphragm.
- 2. Strictly follow the wiring method, otherwise it may cause product damage or other potential faults.
- 3. Misuse of the product may cause danger or personal injury.
- 4. Pressure range can be selected higher or lower than actual conditions, but should be within ±30%FS.
- 5. Pressure reference consists of gauge pressure, absolute pressure, and sealed gauge pressure.
 - a. Gauge pressure is based on the current atmospheric pressure. Generally, it refers to the measurement of pressure which is greater than the current atmospheric pressure. Negative pressure is a special case of gauge pressure. It refers that there is such working condition that the pressure of work site is lower than the current atmospheric pressure.
 - b. Absolute pressure is based on vacuum.
 - c. Sealed gauge pressure uses absolute pressure die for gauge pressure product based on the atmospheric pressure of production site.
- 6. Confirm the maximum overload of the applied system, which should be less than the overload protection limit of the sensor, otherwise it will affect the product life or even damage the product.
- 7. The material and process for manufacturing negative pressure sensors are different from those of positive pressure sensors. So, gauge pressure sensors cannot be used as substitue of negative pressure sensors.

Additional Resources: Product Page | 3D Model

CUI DEVICES | SERIES: PS05 | DESCRIPTION: PRESSURE SENSOR

date 08/05/2022 | **page** 5 of 5

REVISION HISTORY

rev.	description	date
1.0	initial release	12/09/2021
1.01	logo, datasheet style update	08/05/2022

The revision history provided is for informational purposes only and is believed to be accurate.



CUI Devices offers a one (1) year limited warranty. Complete warranty information is listed on our website.

CUI Devices reserves the right to make changes to the product at any time without notice. Information provided by CUI Devices is believed to be accurate and reliable. However, no responsibility is assumed by CUI Devices for its use, nor for any infringements of patents or other rights of third parties which may result from its use.

CUI Devices products are not authorized or warranted for use as critical components in equipment that requires an extremely high level of reliability. A critical component is any component of a life support device or system whose failure to perform can be reasonably expected to cause the failure of the life support device or system, or to affect its safety or effectiveness.